



Applies To: **1999–2000 Odyssey EX – ALL**
2001 Odyssey EX – From VIN 2HKRL18..1H500001 thru 2HKRL18..1H521371

August 7, 2001

Driver’s Seat-Back Sometimes Changes Position

SYMPTOM

After entering or exiting the vehicle, the driver notices that the seat-back has changed position.

PROBABLE CAUSE

The driver’s seat recline knob is too long, allowing the driver to accidentally bump the switch with his or her thigh when entering or exiting the vehicle.

CORRECTIVE ACTION

Replace the recline knob.

PARTS INFORMATION

Recline Knob

Light Quartz Gray (NH284L):
 P/N 35952-S0X-J61ZA, H/C 6553705

Mild Beige (YR169L):
 P/N 35952-S0X-J61ZB, H/C 6548986

Fern (G49L):
 P/N 35952-S0X-J61ZC, H/C 6553713

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

OP#	Description	FRT	Template ID
749125	Replace recline knob, Light Gray (NH284L)	0.2	01-066A
	Replace recline knob, Mild Beige (YR169L)		01-066B
	Replace recline knob, Fern (G49L)		01-066C

Failed Part: P/N 35952-S87-A51ZA
 H/C 5435722

Defect Code: 077


Contention Code: B99

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Remove the original knob by pulling it away from the seat.

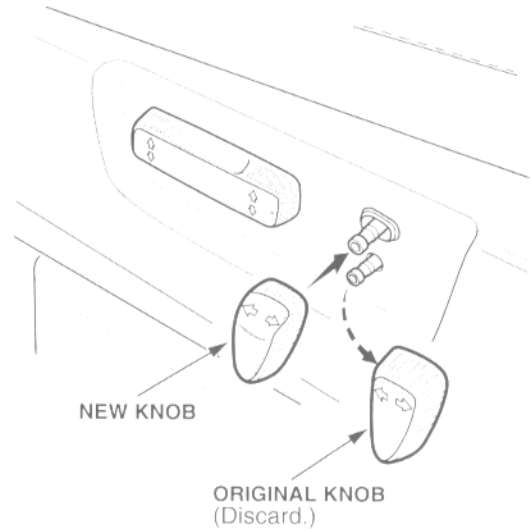

2. Install the new knob, making sure that the forward and backward arrows are at the top.



CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by “do-it-yourselfers,” and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.