



Applies To: **1999-01 Odyssey – ALL**
2002 Odyssey – From VIN 2HKRL18..2H500001 thru 2HKRL18..2H507787

December 11, 2001

Rear Wiper Arm Is Loose

PROBLEM

The rear wiper arm is loose.

CORRECTIVE ACTION

Clean the splines of the wiper motor shaft, and install a new flange nut.

PARTS INFORMATION

Rear Wiper Flange Nut:
P/N 94050-06080, H/C 0612689

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 741155

Flat Rate Time: 0.2 hour

Failed Part: P/N 76722-S0X-A01
H/C 5936059

Defect Code: 032

Contention Code: B01


Template ID: 01-096A

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Remove the wiper arm cap, the nut, and the wiper arm. Discard the nut.

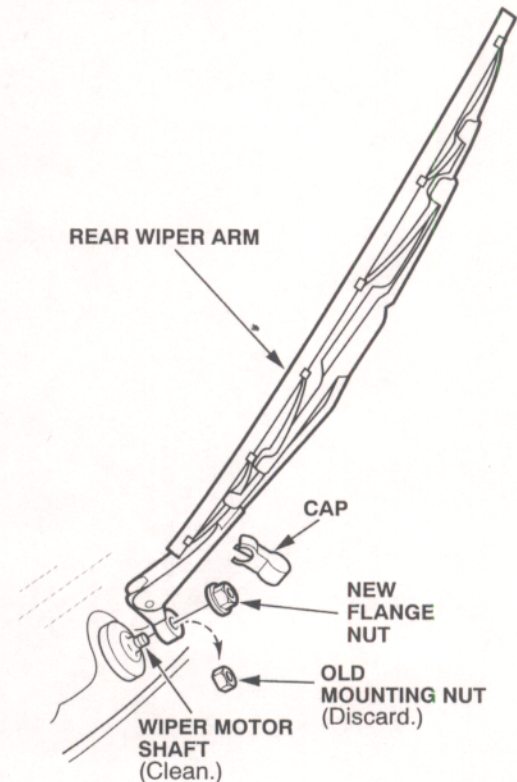

2. Using a wire brush, remove any wiper arm material from the splines of the wiper motor shaft.
3. Install the rear wiper arm onto the motor shaft in the park position.
4. Install the new flange nut, and torque the nut to 11.7 N·m (8.6 lb-ft).
5. Install the wiper arm cap.
6. Wet the rear window, and turn on the rear wiper to make sure it works properly.